



SERVICE BULLETIN

Classification:

EL09-007

Reference:

NTB09-016

Date:

March 11, 2009

2009 370Z; DOOR WINDOW OPERATION

APPLIED VEHICLES: 2009 370Z (Z34)

IF YOU CONFIRM:

Upon opening either the driver's or passenger's door, the door windows cannot be raised with the door open.

AND

The battery state-of-charge is low.

OR

The battery (for whatever reason) had been temporarily disconnected.

ACTIONS:

DO NOT replace the power window motor or power window switch.

If the battery state-of-charge is low: Service the battery as indicated by use of the Midtronics GR-8 Battery and Diagnostic Station using standard Warranty procedures.

Re-initialize the windows using the service procedure on page 2.

NOTE: This procedure can also be found in Section 2 of the 370Z Owner's Manual.

- The power window has an automatic adjusting function.
- When the door is being opened, the window is automatically lowered slightly to avoid contact between the window and the side roof panel.
- When the door is closed, the window is automatically raised slightly.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Push the ignition switch to the ON position.
2. Close the door.
3. Open the window more than halfway by operating the power window switch.
4. Pull the power window switch and hold it to close the window, and then hold the switch more than 3 seconds after the window is closed completely.
5. Release the power window switch. Operate the window by the automatic function to confirm the initialization is complete.
6. Performs steps 2 through 5 above for the other window.

